



IN APPLIED SCIENCE & ENGINEERING TECHNOLOGY

Volume: 3 Issue: II Month of publication: February 2015 DOI:

www.ijraset.com

Call: 🛇 08813907089 🕴 E-mail ID: ijraset@gmail.com

## International Journal for Research in Applied Science & Engineering Technology (IJRASET) Effect of Machining Parameters on Surface Roughness of End Milling

Er. N. Balasubramanyam<sup>1</sup> M.Tech., Er. P. Gnana Prakash<sup>2</sup> M.Tech, Dr.V.Palvannan<sup>3</sup> M.E., Ph.D, Er.M.Yugandhar<sup>4</sup> M.Tech

Abstract: This research work deals with the investigation on the effect of process parameters on surface roughness in end milling process. Surface roughness plays an important role in deciding the quality of machining. Mathematical model has been developed to predict the surface roughness in terms of machining parameters such as helix angle of cutting tool, spindle speed, feed rate, and depth of cut. Central composite rotatable second order response surface methodology was employed to create a mathematical model and the adequacy of the model was verified using analysis of variance. The experiments were conducted on stainless steel SS 202 by carbide end mill cutter and the surface roughness was measured using Mituotyo surface test SJ201. The direct and interaction effect of the machining parameter with surface roughness were analyzed, which helped to select the level process parameter in order to ensure quality of end milling. Keywords: Milling Machine, roughness tester.

#### I. INTRODUCTION

Quality and productivity play significant role in today's manufacturing market. From customers viewpoint quality is very important because the extent of quality of the procured item (or product) influences the degree of satisfaction of the consumers during usage of the procured goods. Therefore, every manufacturing or production unit should concern about the quality of the product. Surface roughness plays an important role in product quality and manufacturing process planning. The aim of this study is to identify suitable parameters for the prediction of surface roughness. The various factors that affect Surface roughness are vibrations, material of the work piece, type of machining, rigidity of the system (consisting of machine tool, holding devices, material of tool and work piece), cutting conditions, and type of coolant used. Surface roughness is the important parameter which decides the quality of end milling operation. An effective model to predict the surface roughness becomes essential to ensure the quality and increased productivity in end milling process. A mathematical model has to be developed to predict surface roughness in terms of machining parameters such as helix angle, spindle speed, feed rate and depth of cut. The direct and interaction effect of the machining parameters on surface roughness during milling has to be analyzed.

#### II. HARDWARE REQUIREMENTS

The hardware required for this experiment is as follows,

A. SIE Vertical Machining Center



Fig 1 : SIE vertical mill-1

www.ijraset.com

### International Journal for Research in Applied Science & Engineering Technology (IJRASET)

Specification sheet: SIE vertical tool room mill Model tm-1 s/n 38380 new 10/2005 Table dimensions 10.5" x 47.45" Table load capacity 1000 lbs X-travel 30" Y-travel 12" Z-travel 16" Spindle taper #40 Spindle rpm 0 - 4000 Horsepower 7.5 hp Rapid traverse (x, y, z) 200 ipm Approx. dimensions 85"w x 64" d, x 106" h Approx weight 3300 lbs Equipped with: SIE cnc control Rigid tapping (to be verified) Spray mist coolant Quick code programming system

#### B. Milling

Milling is the process of cutting away material by feeding a workpiece past a rotating multiple tooth cutter. The cutting action of the many teeth around the milling cutter provides a fast method of machining. The machined surface may be flat, angular, or curved. The surface may also be milled to any combination of shapes. The machine for holding the workpiece, rotating the cutter, and feeding it is known as the Milling machine.




Fig 2.1:Milling Operations



Fig 2.2: Work piece SS 200(32 specimens)

#### C. Surface Roughness

Surface roughness is the measure if the finer surface irregularities in the surface texture. These are the result of the manufacturing process employed to create the surface. Surface roughness Ra is rated as the arithmetic average deviation of the

surface valleys and peaks expressed in micro inches or micro meters. ISO standards use the term CLA (Center Line Average). Both are interpreted identical.

The ability of a manufacturing operation to produce a specific surface roughness depends on many factors. For example, in end mill cutting, the final surface depends on the rotational speed of the end mill cutter, the velocity of the traverse, the rate of feed, the amount and type of lubrication at the point of cutting, and the mechanical properties of the piece being machined. A small change in any of the above factors can have a significant effect on the surface produced.

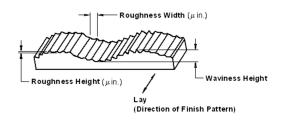


Fig 2.3.Surface roughness Norman culture



Fig 2.4 Surface roughness measurement

Surface roughness of a machined product could affect several of the product's functional attributes, such as contact causing surface friction, wearing, light reflection, heat transmission, ability of distributing and holding a lubricant, coating, and resisting fatigue.

#### III. FACTORS INFLUENCING SURFACE ROUGHNESS IN END MILLING

Generally, it is found that the factors influencing surface roughness in turning are:

A. Depth of cut

Increasing the depth of cut increases the cutting resistance and the amplitude of vibrations. As a result, cutting temperature also rises. Therefore, it is expected that surface quality will deteriorate.

#### B. Feed

Experiments show that as feed rate increases surface roughness also increases due to the increase in cutting force and vibration.

#### C. Cutting speed

It is found that an increase of cutting speed generally improves surface quality.

#### D. Engagement of the cutting tool

This factor acts in the same way as the depth of cut.

#### *E. Cutting tool wears*

The irregularities of the cutting edge due to wear are reproduced on the machined surface. Apart from that, as tool wear increases, other dynamic phenomena such as excessive vibrations will occur, thus further deteriorating surface quality.

#### *F.* Use of cutting fluid

The cutting fluid is generally advantageous in regard to surface roughness because it affects the cutting process in three different ways. Firstly, it absorbs the heat that is generated during cutting by cooling mainly the tool point and the work surface. In addition to this, the cutting fluid is able to reduce the friction between the rake face and the chip as well as between the flank and the machined surface. Lastly, the washing action of the cutting fluid is considerable, as it consists in removing chip fragments and wear particles. Therefore, the quality of a surface machined with the presence of cutting fluid is expected to be better than that obtained from dry cutting. Finally, the set of parameters including the above mentioned parameters that are thought to influence surface roughness, have been investigated from the various researchers.

#### G. Stainless Steel 200 (SS200)

Stainless Steel 200 Grade is in a hot rolled Coil form. After processing the Stainless Steel hot rolled coil it gets converted into cold rolled coil which is used in different forms according to the thickeness, Width and the size. The cold rolled is processed into different product such as Stainless Steel Sheet and Plate, Stainless Steel Coil, Stainless Steel Tubes and Pipes etc. The use of Stainless steel coil and strips are increasing used in the process industries, Automobiles, Food & Dairy Industries, Sugar Industries, Watch Industries, Pipes & Tubes Industries, Utensils, Furniture, Architectural Utilities, Thermowares, Chemical process Industries, Electronic Industries, Surgical industries, etc. There is a greater awareness on the use of stainless steel in the building and construction sector. According to latest studies use of stainless steel are also increasing in the industries like food processing industries, Rail industries and Telecommunication industries.



Figure -3: Carbide end-mill cutter

Table-3.1 Milling machine cutting for high speed steel milling cutters

	CUTTING SPEED (sfpm)1 2										
MATERIAL	PLAIN MILLIN	G CUTTERS	END MILLING CUTTERS								
	Roughing	Finishing	Roughing	Finishing							
Aluminum	400 to 1,000	400 to 1,000	400 to 1,000	400 to 1,000							
Brass, composition	125 to 200	90 to 200	90 to 150	90 to 150							
Brass, yellow	150 to 200	100 to 250	100 to 200	100 to 200							
Bronze, phosphor and manganese	30 to 80	25 to 100	30 to 80	30 to 80							
Cast iron (hard)	25 to 40	10 to 30	25 to 40	20 to 45							
Cast iron (soft and medium)	40 to 75	25 to 80	35 to 65	30 to 80							
Monel metal	50 to 75	50 to 75	40 to 60	40 to 60							
Steel, hard	25 to 50	25 to 70	25 to 50	25 to 70							
Steel, soft	60 to 120	45 to 110	50 to 85	45 to 100							

For carbon steel cutters, decrease values by 50 percent. 2 For carbide-tipped cutters, increase values by 100 percent

- H. Chemical Composition of SS200
- C 0.15%
- Mn 9.25%
- Si 0.49%
- Cr 17.1%
- Ni 4.1%
- P 0.06%
- S 0.03%
- N 0.25%

Fe - 70.01% Size of the work piece L\*B\*T=100\*75\*40

I. Mituotyo Surface Test SJ200



Fig 3.1 Portable Surface Roughness Tester

#### J. Mitutoyo SJ-201P Features

- 1) Large characters are displayed on the large easy-to-view LCD.
- 2) Portable for easy measurement anywhere necessary.
- 3) The detector/drive unit can be detached from the display unit for effortless measurement
- 4) Wide  $350\mu m$  (-200 $\mu m$  to +150 $\mu m$ ) measurement range.
- 5) Roughness parameters compatible with ISO, DIN, ANSI, and JIS.
- 6) 19 analysis parameters are provided, including the basic Ra, Rq, Rz, and Ry parameters.
- 7) Customize function allows hiding of unnecessary parameters.
- 8) GO/NG judgment on a desired parameter.
- 9) Auto-calibration for simple gain-adjustment.
- 10) 10 Measurement data is retained in memory even after the power is turned off.
- 11) Data output is available for SPC operation.
- 12) RS-232C interface enables data transfer to computer or other devices using an external device.
- 13) A dedicated carrying case is included for safe transport

#### K. Software Requirements

(I)Quality America QC - IV statistical software: Developing mathematical model for the response surface roughness measured by the experiments for various machining parameters levels by using Quality America QC - IV statistical software.

(II) Microsoft office Excel : The direct and interaction effect of variables are analyzed and plotted by Excel.Direct effect means only change in speed ,feed, cutting angle.Interction effect means change both Speed and feed or speed and cutting angle.

#### IV. DEVELOPMENT OF MATHEMATICAL MODEL

Some of the softwares used in the determination of regression coefficients are as follows:

Quality America (DOE-PC IV) Minitab

MS Excel

Design Expert

Among these softwares, using the Quality America Six Sigma Software (DOE- PC IV) been found to be easier to calculate the regression coefficients. Hence, This software is used for experimental study purpose.

A. Steps In Finding Regression Coefficients

The steps used in finding the regression coefficients are explained as follows:

STEP 1:

International Journal for Research in Applied Science & Engineering

**Technology (IJRASET)** 

lew			
ipen	Ctrl+F12 Ctrl+F4		- 🗆 🗵
lose All	C01+F4		
IVE	Shift+F12		
eve As	F12	Precision (%)	
nport Analysis Array			<u> </u>
oport File			
int			
ninter Setup			
D:\MANOJ.DOE			
D:\MANOJ.DOE C:\USERS\SATHISH\DESKTOP\AZAF			
ot	Alt+F4		
			<u> </u>

A new file of DOE-PC IV software is opened.

#### **STEP 2:**

"Edit" option is chosen from the standard tool bar and now the "Add parameter "option is chosen from the drop down menu.

Copy Paste	Ctrl+C Ctrl+V				
Column Width Remove Response Colum	on				_D×
Add Parameter Add Parameter After Edit Parameter	Ins Alt+Ins	Levels	Туре	Precision (%)	
Delete Parameter	Del				
Insert Row(s) Delete Row(s)					
Delete Redundant Rows Sort Array					
					<u> </u>

#### **STEP 3:**

Then the name of the input parameter is given in the "Parameter label" and level input parameter is taken as five .

Parameter Information Project Description	n: Untitled	Parameter Information		
hoject Description	Class	Parameter Labet helix any		
		Class C Main Factor C Subsidiary Factor C Blocking Factor C Backing Factor C Response C Information/Comment Type Q Qualitative Q	Precision Precessage: Bonder of Levels: Clevels Standard - Equivisered 2 3 4 5 Factor Levels. Factor Levels. OK. Cancel	-

Type parameter label as helix angle and set number of level is

#### **STEP 4**

Now click Factor Units option in parameter information menu and set the user defined unit Select userd defind and type the helix angle unit as degree and set upper constraint value as 50 and lower constraint value is 30, decimal places 0, and then ok

#### **STEP 5**

Similarly, steps 4 and5 are followed to enter all the input parameters like spindle speed, feed rate, and depth of cut along with their respect units and limit values.

Repeat the steps 4and 5 for other parameters like cut and set the correspond unit, upper constraint value, lower constraint value,

decimal places

		8 -1			
A: helix angle	B: speed	C: feed rate	D: depth of cut	E: surface roug	oughnes:
-1	-1	-1	-1	0.288	
-1	1	Response	-	10.0	
	1	Select Resp	anse Column:		
-1	-1	surface roug			Regression by Backwards Elimination
-1	1	1			V Do backwards elimination Probability criterion: 0.75
	1	1			
-1	-1	*			Fitted Response
	-1	Regression	C	<u> </u>	FB Title:
	A: helix an				PR Tuge:
	1 1	C Force the			Studentized Residual
	2 0	C Allow to	float (mixtures)		C Add Studentized Residual Column
	4 0	9	OK	Cancel	SR Title:
	6 0	2	0	0	
		ő	0	2	
	9 1		0	0	

#### STEP 6:

Finally, the values of the regression coefficients are obtained from which the mathematical model is developed. Also, the value of F-ratio and R-ratio are obtained to check the adequacy

File						dow H	teip																		.18)
1¢	6											_													_
dep ic ic ic	d rate th of		LE			1111C0 0.000 1.000 1.000 1.000 1.000 1.000 1.000 1.000 1.000 1.000	nce	20000000000000000000000000000000000000	0.0	189 190 135 142 160 129		000000000000000000000000000000000000000	000 004 004 004 004 004 004 004 004 004				rianc 0.000 0.088 0.088 0.088 0.088 0.088 0.081 0.081 0.081 0.081 0.108 0.108	e	(	Parti 0.00 0.19 0.03 0.47 0.07 0.05 0.05 0.10 0.01 0.01 0.01	011607804324	5)	-223 99 366 14 10 16 -5	000 936 236 089 247 708 690 953 814 749 117 823	
		A		в		С	D	A *	B,		C*		D*		AC		AD	CD							
A BCD A BCD A DCD A DCD A DCD A CD	1	.000	01	000	0	000	0.000 0.000 0.000 1.000	0.000 0.000 0.000 0.000 1.000	 000	00000	000	000-00-00-00-00-00-00-00-00-00-00-00-00	000000000000000000000000000000000000000	000000000000000000000000000000000000000	000000000000000000000000000000000000000	000000000000000000000000000000000000000	000 000 000 000 000 000 000 000 000	0.00 0.00 0.00 0.00 0.00 0.00 0.00 0.0	000000000000000000000000000000000000000						

#### **STEP 7:**

By use in Microsoft office Excel get graphs

-	1	a :									\$\$5	nwvi	/23.xl	s [Con	patil	bility M	ode] -	Microsof	Excel							5
9		Hore	-	Incart	. Pr	ga Layes	t For	mater	De	a i	Tat/a		Vanie													
-		6	Calibr			11 +	A' A'	-	-	1.0		1	Wine Te		Gene	ral		10	112		She	34	E) 🚡	- 57	23	
	19	а.	-				-				-				100			Canditional	-	Del	Inert	Debte Fr			find B.	
-		1		1.5		1.1	- <u>A</u> -	-			1.54	581	Merge 8	Center *		· · ·	26.12	Fernatting	an Table -	Stules -			. 2	Filter -	Select -	
-	ard				Fort						dgnm	418				Number			Styles			Cells		Edites		
_		F2				fe .	+(0.353-	0.009	*#2)+(	0.09*	02)+()			341*020-		*A2*A2)+	0.042*82	*82)+(0.009*		.06*02*0		*#2*C21-I	0.029*42*0			10
1.			0	0																					×	Y
			z	Y	90	PR						-					-				_					
	-1	-5	-4	-1	0.288	0.276	4.35		-2	0			0.288	0.739												
	1	-1	-4	-1	0.3	0.21	-4.76		-8	0		- 0	0.2	0.454												
	-4		-4	-1	0.477	0.454	4.61		0	0	0			0.353		0.8 ]										
5	1		-4	-4	0.401	0.35	2.82		1	. 0			0.401	0.316												
5	-3	-5	1	-1	0.454	0.474	-3.80		2	0	. 0		0.456	0.383			1									
	1	-5		-4	0.293	0.3	-2.33									0.7	1									
	-1			-4	0.666	0.654	1.83		0	-2	- 0	- 0	0.258	0.341												
	1				0.483				0	-3	- 0	- 0		0.305												
10	-1	-1	-4	1	0.679				0	0	0			0.353		0.6 -	1									
13	3	-1	-4	1	0.500				0	1	0			0.485												
1.2	-1		-4	1	0.883				0	2	- 0	. 0	0.456	0.701				1								
3	3		-4	1	0.693											05 -		1								
4	-1	-1			0.738				0	0	-2			0.439												
5	1	-1		1	0.435				0	0	-1			0.357				1								
5	-3			1	0.918				0	- 0	- 0			0.353		0.4 -										
17	3			1	0.601				0	0	1			0.427								/				
8	-2	. 0		. 0		0.725			0		2		0.456	0.579					1		/					
19	2				0.4																_					
20		-2			0.350				0					0.311		** ***										
13 I	-		- 1		0.683					- 0	-			0.272				-	2			1.00	Screenabo	-	_	_
22	-	- 1		- 1	0.415									0.353								1	class between			
18	-	- 1		- 1		0.579					- 1			0.554										_		1
	-	- 1	- 1		0.294							2	0.456	0.875												
- 0	-					0.877																				
	-1	- 1		- 1		0.353																				
								_	_	_	_		_	_		_	_	100						_	_	_
				1.50	eet2./	Sheet3															-		0.0 200%			



Surface roughness is an indicator of quality. It is obtained from processed pieces by means of fend milling and accurate control of the dynamic variables, such as rotation speed, feed rate and cut depth. Surface roughness is affected as well by other variables, like the mechanical properties of the material, the geometry of the milling cutter, the number of inserts, the run out errors in the inserts and the vibration produced during the process. The quality of the machined surface has a very important role in the production of complex shapes like precision molds and the production of an engraving matrix.

#### A. Overview Of The Research Work

Select cutting tool and work piece materials for cutting the experiments.

Example: Cutting tool - Carbide end mill cutter,

#### Work piece material - SS200.

1) Identify the machining parameters and its level which affect surface roughness during end milling

- 2) Central composite rotatable second order response surface methodology (Experimental Design) was employed for conducting experiments
- 3) Developing mathematical model for the response surface roughness measured by the experiments for various machining parameters levels by using Quality America QC IV statistical software.
- 4) Checking the adequacy of the model developed by applying analysis of variance (ANOVA) technique.
- 5) The direct and interaction effect of variables are analyzed and plotted by Excel.
- 6) Documentation and report preparation.

#### VI. DESIGN OF EXPERIMENTS

Design of experiments is a statistical technique used to study multiple variables simultaneously. Sir. R. A. Fisher of England introduced DOE in early 1920's. His primary goal was to find the optimum water, rain, sunshine, fertilizer, and soil condition needed to produce the best crop. Using the DOE technique, Fisher was able to lay out all combination of the factors included in experiment study. The conditions were created using a matrix, which allowed each factor an equal number of test conditions. Methods for analyzing the results of such experiments were also introduced. When the number of combinations possible became too large, schemes were devised to carry out a fraction of the total possibilities such that all factors would be evenly present.DOE is highly effective wherever and whenever it is suspected that the performance of a part or process is controlled by more than one factor.



Fig-6 Experimental setup

#### A. Response Surface Methodology

In statistics, response surface methodology (RSM) explores the relationships between several explanatory variables and one or more response variables. The method was introduced by G. E. P. Box and K. B. Wilson in 1951. The main idea of RSM is to use a sequence of designed experiments to obtain an optimal response. Box and Wilson suggest using a second-degree polynomial model to do this. They acknowledge that this model is only an approximation, but use it because such a model is easy to estimate and apply, even when little is known about the process. The advantages of design of experiments are as follows:

- 1) Number of trials is reduced.
- 2) Optimum values of parameters can be determined
- 3) Assessment of experimental error can be made.
- 4) Qualitative estimation of parameters can be made.
- 5) Inference regarding the effect of parameters on the characteristics of the process can be made.

Response surface methodology is the most informative method of analysis of the result of a factorial experiment. In the present work, helix angle of cutting tool, spindle speed, feed rate, depth of cut have been considered as the process parameters and the surface roughness are taken as a response variable (table 6.1). The response surface roughness 'S' can be expressed as a function of process parameters helix angle ( $\alpha$ ), spindle speed (N), feed rate (Z), depth of cut (Y).

Surface roughness,  $S = \varphi$  (aiu, Niu, Ziu, Yiu) + eu

Where  $\phi$  = response surface, eu = residual, u = no of observations in the factorial experiment and iu represents level of the i<sup>th</sup> factor in the u<sup>th</sup> observation. When the mathematical form of  $\phi$  is unknown, this function can be approximated satisfactorily within the experimental region by polynomials in terms of process parameter variable. Box and Hunter proposed central composite rotatable design for fitting a second order response surface based on the criterion of rotatability. The selected design plan chosen consists of 32 experiments (table 8.2). It is five factors - five levels central composite rotatable design consisting of 32 sets of coded conditions. The design for the above said experiment comprises of a<sup>1</sup>/<sub>2</sub> replication of 25 (=16) factorial design

plus 6 center points and 10 star points. These correspond to first 16 rows, the last 6 rows and rows from 17 to 26 respectively in the design plan shown. For  $\frac{1}{2}$  replicate the extra point included to form a central composite design,  $\alpha$  becomes 2(k-1)/4 = 2. The upper limit of the parameter is coded as 2, lower limit as -2 and the coded values for intermediate values were calculated from the following relationship :

$$X_{i} = \frac{2(2X - (X_{\max} + X_{\min}))}{(X_{\max} - X_{\min})}$$

Where,

Xi – The required coded value of a variable X,

X – Is any value of the variable from X min to X max

Xmin – Is the lower limit of the variable.

Xmax - Is the upper limit of the variable.

The intermediate values coded as -1, 0 and 1.



Fig 6.1 Measurement of Surface Roughness - Mitutyo surf test SJ-200

#### B. Input Parameters

The following input parameters were chosen for the analysis

- 1) Helix angle ( $\alpha$ )
- 2) Spindle speed (N)
- 3) Depth of cut (Y)
- 4) Feed rate (Z)
- C. Output Responses

The following were the output responses chosen for the analysis

*l)* Surface roughness(S)

#### D. Limits Of Parameters


The design matrix selected for the experiment is four factor five level central composite rotatable design.


#### Table 6.4 Parameters and levels in milling

Parameter	Units			Factor levels	5	
		-2	-1	0	1	2
Helix angle (a)	Degree ( <sup>0</sup> )	30	35	40	45	50
Spindle speed (N)	Rpm	2000	2500	3000	3500	4000
Feed rate (Z)	mm/rev	0.02	0.03	0.04	0.05	0.06
Depth of cut (Y)	Mm	1.5	2	2.5	3	3.5

#### II. EXPERIMENTAL SETUP

The experiments were conducted on a HASS vertical machining center: model tool room mill with carbide end mill cutter under dry condition. The work piece material was SS201 commonly available machinable metal which finds application in automobile and valve industries. The dimension of the work piece specimen was 32mmX32mm in cross section and 40 mm in length. The surface roughness was measured by using Mituotyo surface test SJ201on the flank surface of the end mill cutter specimen and the observations are tabulated to obtain the mathematical model

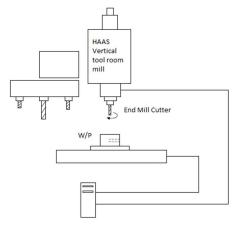



#### A. Development of Mathematical Model

The general form of a quadratic polynomial which gives the relation between response surface 'y' and the processvariable 'x' under investigation is given by

$$y = b_0 + \sum_{i=1}^{k} b_i x_i + \sum_{i=1}^{k} b_{ii} x_i^2 + \sum_{i < j} b_{ij} x_i x_j$$

Where

 $b_0 = constant$ ,

 $b_i = linear term coefficient,$ 

 $b_{ii}$  = quadratic term coefficient and

 $b_{ij}$  = interaction termcoefficient.

The values of the coefficients of the polynomials were calculated by multiple regression method. A statistical software QA Six Sigma DOEPC IV was used to calculate the values of these coefficients. The second ordermathematical model was developed by neglecting the insignificant coefficients of the the surface roughness(S)

 $Surfaceroughness(S) = (0.353(0.089*\alpha) + (0.09*N) + (0.035*Z) + (0.141*Y) + (0.052*\alpha*\alpha) + (0.042*N*N) + (0.039*Z*Z) + (0.06*Y*Y) + (0.027*\alpha*Y) - (0.029*\alpha*Y) - (0.037*Z*Y))$ 

#### Where

- $\alpha$  = Helix angle in (0)
- N = cutting speed in RPM
- Z = Feed rate in mm/rev
- Y = depth of cut in mm

*B. Analysis of variance for testing adequacy of the models* The conditions for mathematical model to be adequate

1) F ratio<Standard Tabulated Value

2) R ratio>Standard Tabulated Value

F Ratio = Lack of Fit/Pure Error

R Ratio= Factors/Pure Error

The observed values from the ANNOVA calculations are....

Table 7.1 Adequacy of the model

Response	Factors df	Lack of Fit -df	Pure Erro r		-ratio ndard	R-	ratio	Whether Model is adequate
				Model	Standard	Model	Standard	
Surface roughness	11	13	6	1.58	4.03	98.733	3.98	Adequate

The adequacy of the model was tested using the analysis of variance (ANOVA) technique (table 8.1). The calculated F-ratio of the model does not exceed the standard value and the calculated R-ratio of the model is above the standard value for a desired 95% level of confidence. It is evident from the table 3 that the error between the experimental value and predicted value is less than 5%.

Table-7.2 Experimental design - Central composite design matrix

Specimen		Control	Factors		Surface roughness (mm)					
No	α	N	Z	Y	Observed	Predicted	%			
01	-1	-1	-1	-1	0.288	0.276	4.35			
02	1	-1	-1	-1	0.2	0.21	-4.76			
03	-1	1	-1	-1	0.477	0.456	4.61			
04	1	1	-1	-1	0.401	0.39	2.82			
05	-1	-1	1	-1	0.456	0.474	-3.80			
06	1	-1	1	-1	0.293	0.3	-2.33			
07	-1	1	1	-1	0.666	0.654	1.83			
08	1	1	1	-1	0.483	0.48	0.63			
09	-1	-1	-1	1	0.679	0.69	-1.59			
10	1	-1	-1	1	0.508	0.508	0.00			
11	-1	1	-1	1	0.881	0.87	1.26			
12	1	1	-1	1	0.692	0.688	0.58			
13	-1	-1	1	1	0.738	0.74	-0.27			
14	1	-1	1	1	0.439	0.45	-2.44			
15	-1	1	1	1	0.918	0.92	-0.22			
16	1	1	1	1	0.601	0.63	-4.60			
17	-2	0	0	0	0.727	0.739	-1.62			
18	2	0	0	0	0.4	0.383	4.44			
19	0	-2	0	0	0.358	0.341	4.99			
20	0	2	0	0	0.683	0.701	-2.57			
21	0	0	-2	0	0.415	0.439	-5.47			
22	0	0	2	0	0.605	0.579	4.49			
23	0	0	0	-2	0.296	0.311	-4.82			
24	0	0	0	2	0.891	0.875	1.83			
25	0	0	0	0	0.37	0.353	4.82			
26	0	0	0	0	0.339	0.353	-3.97			
27	0	0	0	0	0.37	0.353	4.82			
28	0	0	0	0	0.341	0.353	-3.40			

29	0	0	0	0	0.37	0.353	4.82
30	0	0	0	0	0.341	0.353	-3.40
31	0	0	0	0	0.338	0.353	-4.25
32	0	0	0	0	0.360	0.343	-3.50

#### VIII. RESULTS AND DISCUSSION

A mathematical model was developed to predict the surface roughness by relating it with process parameters such as helix angle, spindle speed, feed rate, depth of cut. The direct and the interaction effects of these process parameters on surface roughness were calculated plotted are shown in figs.and the cause and effect were analyzed. The trends of the potted direct and the interaction effect of these process parameters help to determine which parameter and parameter interactions are statistically significant in improveing the surface finish. For surface finish ss ,most of the parameters are found to be apparently significant because the levels of significance of each parameter and interaction parameter factors are almost the same.

#### A. Direct effect of variables

In this work, the effects of helix angle, spindle speed, feed rate, depth of cut were experimentally investigated. From figs. 8.1-8.4 it is clear that the helix angle, spindle speed, axial depth of cut and radial depth of cut have a significant effect on surface finish. Irregulaties produced on the surface of the specimen by the cutting tool are termed as surface roughness. The main factors that determine the surface roughness are built up edge, rate of feed and vibrational deflection between tool and the work. The build up edge sheds the fragments of the chip on the surface and is responsible for the fuzzy appearance. Anything that can be done to prevent of stabilize a built up edge generally improve surface quality

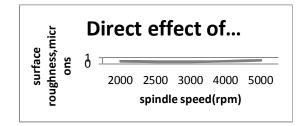


Fig 8.1.Direct effect of helix angle

#### B. Interaction effect of depth of cut and feed rate

Fig 8.2shows the interaction effect of depth of cut feed rate on surface roughness. The observed surface roughness is better only at low feed and high depth of cut. From the graph it is found that the feed is more significant factor than other parameters; whilst depth of cutis the least significant parameter. Further more, the surface roughness reduces with the increase of cutting speed and depth of cut and it increases as the feed increases.

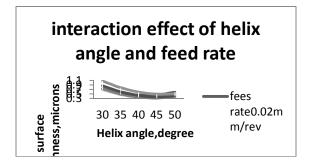


Fig8.2 interaction effect of helix angle and feed rate

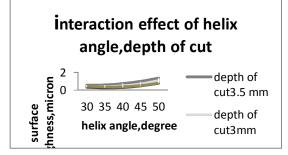


Fig 8.3 interaction effect of helix angle and depth of cut

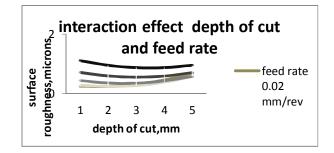


Fig 8.4 interaction effect of depth of cut and feed rate

#### IX. CONCLUSION

The investigation presented a central composite rotatable second order methodology to develop a mathematical model to predict surface roughness in terms of helix angle of cutting tool, spindle speed, feed rate, depth of cut. were arrived from the results of this research work The increase in helix angle of the end mill cutter resulted in better surface finish and there is no much change in surface roughness for helix angle 45 and 50. The decrease in spindle speed resulted reduced surface roughness and it is very effective at the middle level i.e., at a spindle speed 2500 rpm and 3000 rpm. The decrease in feed rate resulted reduced surface roughness is found to be nearly constant for the depth of cut that ranges from 1 mm - 2.5 mm. Beyond that the roughness value is found to increase at a steady rate and may result in poor surface finish. The surface roughness is minimum when the helix angle and feed rate are respectively at their middle value and maximum when helix angle and feed rate at their lower limits . The increase in helix angle resulted in increase so for all the levels of depth of cut.

#### REFERENCES

[1]P. Thangavel and V.Selladurai(2009), An experimental investigation on the effect of turning parameters on surface roughness, Int. J. Manufacturing Research, Vol. 3, No. 3, P.No285-299

[2]JingYingZhang, StevenY.Liang, JunYao ,JiaMingChen,(2006) Evolutionary optimization of machining processes JIntellManuf17:203-215DOI10.1007/s10845-005-6637-z

[3] N.Dhar, M.Kamruzzaman(2006), Cutting temperature, toolwear, surface roughness and dimensional deviation in turning AISI4037 steel under cryogenic..., International Journal of Machine, Tools& Manufacturedoi: 10.1016/j.ijmachtools.2006.09.018

[4] VedatSavas & CetinOzay(2007), The optimization of the surface roughness in the process Of tangential turn-milling using genetic algorithm, IntJ Adv Manuf Technol 37:335-340DOI10.1007/s00170-007-0984-1

[5]Ching-KaoChang: H.S.Lu(2006), Study on the prediction model of surface roughness for side milling operations DOI10.1007/s00170-005-2604-2, IntJ Adv Manuf Technol 29:867–878

[6].Dr.Saad Kareem Shather, Abbas Fadhel Ibrheem(2007), Prediction of Surface Roughness in End-Milling with Multiple Regression Model, Eng.&Tech.Vol.26,No.3,2008

[7] Umesh Khandey(2007), optimization of surface roughness, material, Removal rate and cutting tool flank wear in Turning using extended taguchi approach,

www.ijraset.com

### International Journal for Research in Applied Science & Engineering

### **Technology (IJRASET)**

AUTHORS PROFILE

1. Er.N. Balasubramanyam<sup>1</sup> M.Tech. Assistant Professor, Dept of Mechanical Engineering, Sreenivasa Institute of Technology and Management Studies (Autonomous), Chittoor-517127, A.P. India. 2. Er.P.Gnana Prakash<sup>2</sup><sub>M.Tech.</sub> Assistant Professor Dept of Mechanical Engineering, Sreenivasa Institute of Technology and Management Studies (Autonomous), Chittoor-517127, A.P, India. 3. Dr.V. Palvannan<sup>3</sup> M.E., Ph.D Professor Dept of Mechanical Engineering, Sreenivasa Institute of Technology and Management Studies (Autonomous), Chittoor-517127, A.P, India. 4. Er.M.Yugandhar<sup>4</sup> <sub>M.Tech.</sub> Assistant Professor Dept of Mechanical Engineering, Sreenivasa Institute of Technology and Management Studies (Autonomous), Chittoor-517127, A.P, India.











45.98



IMPACT FACTOR: 7.129







# INTERNATIONAL JOURNAL FOR RESEARCH

IN APPLIED SCIENCE & ENGINEERING TECHNOLOGY

Call : 08813907089 🕓 (24\*7 Support on Whatsapp)